		SP II, Brgy.   ) 545-7166 t	<b>SE PHILIPPINE INC.</b> La Mesa, Calamba City, Laguna o 69	INVESTIGATION REPORT FORM (IRF)  Inhouse Detection					
Custor	mer		NIDEC SUBIC	0.000					
Item C			VR-D		Attention To Gerald De Guzman				
	escription		RYZXD000003 BOX	Department PRODUCTION  Date of Detection 22 09 13					
	rder Number		JO22-M-01958-27		on Detected		22 09 13  QA-SCREENING		
		RATION O	F THE PROBLEM	Jectic					
	ILLUGII	TATION O	THETROBELIN		Major ot Quantity (pcs.)	Reject Qua	Minor	Reject Percentage	
	レレ			•	1,000	Neject Qua			
				Natur	e of Defect:	4		4.00%	
	ILLUSTR			Natur	e of Defect.	INK S	TAIN		
				Requi	rement:				
						No occurrence	e of ink stain		
		E NID	本電産シンボ株式会 EC-SHIMPO CORPORATI	Actua	l:				
	_				bla	ack stain on differe	ent areas of th	e item	
	NO. OF OCCURRENCE		DISPOSITION		AREA OF OCC	URRENCE / ORIG	SIN	CONTENT	
	First		Hold		Slotter	Gluing		Material	
	Recurrence		Special Acceptance		EQOS	Vertica	d	Dimension	
	No.:		For Rework		Diecut	Others	:	Appearance	
	Date:		Reject / Disposal		Detaching			Process / Method	
	Issued by		Checked by		Approved b	ру		Received by (Receiving Section)	
	Rochelle Evangelista QA/IE Staff		Roderick Ramos QA Sr. Supervisor		Rexel Alma QA Asst. Man			erald De Guzman Head/ Supervisor	
			I. INVESTIGAT	ION / A	NALYSIS		104.0	Printer of	
	DIRECT CAUSE: (Analyze	e the reaso	on of occurrence, why it happened?)		INDIRECT CAUSE	E: (Analyze the rea	ason of occurr	rence, why it leaked?)	
D D	Why 1:			Why 1:					
rainir	Why 2:			Why 2:					
System / Training	Why 3: P/A			Why 3:		10/	A		
Syste	Why 4:			Why 4:					
	Why 5:			Why 5:					
SE .	Why 1:			Why 1:					
Design / Toolings	Why 2:			Why 2:					
T / ng	Why 3:			Why 3:	Why 3:				
Desiç	Why 4:			Why 4:					
5275	Why 5:			Why 5:					
<u>m</u>	Why 1:			Why 1:					
Process / Material	Why 2:			Why 2:					
SS / N	Why 3:	PLS. SEE ATTACKED			PL	s. set	ATTA	4 WED	
roces	Why 4:			Why 4:	•				
<u>a</u>	Why 5:								

#### KANEPACKAGE PHILIPPINE INC.

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna Telephone No. (049) 545-7166 to 69 Fax No. (049) 545-6302

## INVESTIGATION REPORT FORM (IRF)

Fax No. (049) 54	13-0302	ALC: NEW YORK	TO SECURE AND DESCRIPTION	Control of the last		eran eran er	A SUPERIN	
			FINAL CON	ICLUSION				
0	CCURRENCE ROOTCAUSE					W ROOTCAUSE		
- REMAINING	PE SIONE OF	BLACK	INK	- RA	NOOMLY OC	conperce		
IMMEDIATE ACTION: (A	ction to be done to contain/ temporal	ry correct the prob	lem found)	CORRECT	VE ACTION: (Actions to be	done to ensure that the	problem will not h	nappen again)
A. Sorting Result					Actions to be done to elir	minate recurrence		Who / When
Loca	ation Total Stock	NG	Total Good					
RM				System	N	/4		-
WIP				Gyotom	•	/4		-
FG								
B. Orientation								
Date	Time			Design /	P	P/A		
Title				Tools				
Attendees								
C. Reworking								
Rework Quantity				Process	PLS.	PLS. SEE ATTACHED		
Total Good								
Rework Percentage (Good)								
II. QA ROOTCAUSE V	/ERIFICATION (To be filled o	out by QA In-c	harge)	Date Conduct	ed:	PIC:		_
	Identified Rootcause				Reco	ommendation		
	NA				N//	A		
	III. CORRE	ECTIVE ACTIO	N VERIFICATI	ON (To be fille	d out by QA In-charge)			
	Checked by	Date	Implem	nented?		Remarks		
1st Verification of Action	K. EVANGUSTA	Doals	Yes	[ ] No	N	A		
2nd Verification of Action		[ ]Yes		[ ] No	,			
3rd Verification of Action			[ ]Yes	[ ] No				
Effectiveness of Action			[]Yes	[ ] No				
	problems occurs for 5 consect or of action still not yet impleme	ented, Trivestiga						
OUALITY ASS	URANCE DEPARTM	ICIVI	IV. CLC	DSURE				
Hatus:	Rem rks.		Appro	ved by:	Process	Owner Acknowled	gment: (Recei	ving Section)
Closed	JSL	h	Daus 23011					
QA Supervis			pervisor	QA Asst.	Manager Li  Date:	ne Leader	Departm Date:	ent Head
Revisive IRRIU & Q	No.	- Julio		Duito.	Date.		Suito.	

# INVESTIGATION REPORT FOR INK STAIN OF NIDEC SUBIC VR-D BOX

	W1	Since Eqos printing unit-2 was down due to motor problem, dark and light color of ink process in Printing unit-1 only to serve the schedule requirement.
DIRECT CAUSE PROCESS/MATERIAL	W2	After finished the black color items, operator change to green color to process the Nidec Subic box.
	W3	Even operator washed the machine for 5mins still there is remaining residue of black ink that caused ink stain.

9/12/2022	CLEMAR	Nidec	NSP003701AB	BF/WK	Black / 9 sec	6.35mm	6.3	1,9	Skip
9/12/2022	CLEMAR	Nidec	NSP003601AB	BF/WK	Black / 9 sec	6.35mm	6.3	1.8	Skip
9/12/2022	CLEMAR	MITSUMI	19Y928G	BF/Uppc	Black / 9 sec	6.35mm	6.3	1.8	Skip
9/12/2022	CLEMAR	MITSUMI	19Y928H	BF/Uppc	Black / 9 sec	6.35mm	6.3	1.8	Skip
9/12/2022	CLEMAR	Nidec	NSP003701AB	BF/WK	P-Green / 9sec	6.35mm	6.3	1.8	Skip
9/12/2022	CLEMAR	Nidec	NSP003601AB	BF/WK	P-Green / 9sec	6.35mm	6.3	1.8	Skip
9/12/2022	CLEMAR	Nidec	NSP002901AB	BF/WK	P-Green / 9sec	6.35mm	6.3	1.8	Skip
9/12/2022	CLEMAR	Nidec	NSP003001AB	BF/WK	P-Green/ 9sec	6.35mm	6.3	1.7	Skip
9/12/2022	CLEMAR	Nidec	NSP0028001B	BF/WK	P-Green/9sec	6.35mm	6.3	1.7	Skip

INDIRECT CAUSE (OUTFLOW) PROCESS/MATERIAL	MAIT I	Operator didn't notice the occurrence of ink stain since its occurs randomly in different location together with machine speed of 100bpm Skip On mode.
---	--------	--

### **PRODUCTION CORRECTIVE ACTION**

Orient the operator that if only one printing unit is available, machine cleaning standard must be adjusted to 10minutes from current of 5minutes.

PIC: PRODUCTION TARGET DATE: 220916

PREPARED BY:

GERALD DE GUZMAN PROD ASST. SUPERVISOR APPROVED BY:

WEENAV. APALLA
ASST. MANAGER