

DATE:

KANEPACKAGE PHILIPPINE INC.

AAA

A NA

 $\Lambda \Lambda \Lambda$

AUAVAUA

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna Telephone No. (049) 545-7166 to 69 Fax No. (049) 545-6302

INVESTIGATION REPORT

9	Prepared By:	Check By:	Approved By:		
	MHVITO	N. CEPEDA	R. MIRANDA		
<u>230509</u>	OA-IE/ Prodn IE	OA/ Prodn SV	KPLIMA Operations Gen. Mngr.		
			Ri El Intoperations den: 1 mgr.		

DOCUMENT REVIEW

MAN	No Changes	Affected Document:	Date Reviewed:	Disposition:	PIC:	Target Date:
MACHINE	No Changes	Procedure Manual		With Revision I No Revision	MH.VITO	N/A
MATERIAL	No Changes	Work Instruction	230509	☑ With Revision □ No Revision	MH.VITO	230514
METHOD	No proper checking of sheets	Process Flow	230309	With Revision I No Revision	MH.VITO	N/A
ENVIRONMENT	No Changes	Forms		With Revision I No Revision	MH.VITO	N/A

I. PROBLEM DESCRIPTION

5M REVIEW

1.1. ISSUE:			
	INVERTED LAMINATED OF B FLUTE		
1.2. ITEM DESCRIPTION:			
PART CODE:	516446201		
PART NAME:	PAD ASSY		

1.3. BACKGROUND:



> INVERTED LAMINATED B FLUTE
DETECTED AT LUCIDA ASSY.
>LOT QUANTITY: 100 EA
> REJECT QTY: 100 EA
100 PECENT REJECT

II. IMMEDIATE ACTION

ACTION ITEMS	Target Date:	Person In-charge	
SORTING OF AFFECTED BLOCKS	230505	OPERRATOR/ IE STAFF	
HOLD THE RAW MATS FOR VERIFICATION	230505	LEADER/STAFF	

III. CAUSE ANALYSIS:

WHY 1:	INVERTED LAMINATE OF B-FLUTE FOR 53X53 PAD BLOCKS OCCURED AT MANUAL LAMINATOR. NOTE: THIS WAS FOUND BY PRODUCTION ASSEMBLY.
WHY 2:	DURING LAMINATION PROCESS OF PAD BLOCKS, INVERTED B FLUTE OCCUR WHEN THE FEEDER OPERATOR FEED TWO FLUTE IN A SAME TIME. NOTE: ALL FLUTE MUST BE IN ONE OR IN THE SAME DIRECTION.
WHY 3	UPON PROCESSING OF PAD BLOCKS, CATCHER OPERATOR ALSO FAILED TO CHECK THE POSITION OF THE FLUTE.
WHY 4:	THERE IS NO STANDARD CHECKPOINTS FOR THE FEEDER AND CATCHER OPERATOR SPECIFIED ON THE WORK INSTRUCTION.

IV. ACTION PLAN:

KANEPACKAGE PHILIPPINE INC. No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna		INVESTIGATION REPORT					
	Telephone No. (049) 545-7166 to 69		Prepared By:	C	heck By:	Approved By:	
Fax No. (049) 545-6302		NO. (U99) 593-63U2	MHVITO	N	. CEPEDA	R. MIRANDA	
D	ATE:	<u>230509</u>	QA-IE/ Prodn IE	QA	/ Prodn SV	KPLIMA Operations Gen. Mngr.	
1 REMIND THE OPERATOR REGARDING TO THE ISSUE OF INVERTED FLUTE.			230508				
2 REVISION OF WI FOR THE CHECKPOINT OF THE OPERATOR.			230513				