KANEPACKAGE PHILIPPINE INC. No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna Telephone No. (049) 545-7166 to 69		INVESTIGATION REPORT			
			Prepared By:	Check By:	Approved By:
Fax No. (049) 545-6302		MHVITO	N. CEPEDA	R. MIRANDA	
DATE:	<u>230518</u>		QA-IE/ Prodn IE	QA/ Prodn SV	KPLIMA Operations Gen. Mngr.
5M REVIEW			DOCU		N

MAN	No Changes	Affected Document:	Date Reviewed:	Disposition:	PIC:	Target Date:
MACHINE	No Changes	Procedure Manual		With Revision 🛛 No Revision	MH.VITO	N/A
MATERIAL	SCRAP ON RM	Work Instruction	230518	□ With Revision □ No Revision	MH.VITO	N/A
METHOD	No Changes	Process Flow	230516	With Revision 🛛 No Revision	MH.VITO	N/A
ENVIRONMENT	No Changes	Forms		With Revision 🛛 No Revision	MH.VITO	N/A

# I. PROBLEM DESCRIPTION

1.1. ISSUE:					
	PEEL OFF				
<b>1.2. ITEM DESCRIPTION:</b>	.2. ITEM DESCRIPTION:				
PART CODE:	516298200				
PART NAME:	LOUVRE 2 MCX ICB FOR ASIA; C				
1.3. BACKGROUND:	1.3. BACKGROUND:				
	Image: Details:   Image: Details:				

#### **II. IMMEDIATE ACTION**

ACTION ITEMS	Target Date:	Person In-charge
SEGREGATION OF THE AFFECTED PANEL	230518	OPERATOR
CLEAN THE GLUE ROLLER AND GLUE PLATE	230518	OPERATOR

### III. CAUSE ANALYSIS:

WHY 1:	PEEL OFF WAS DETECTED AT GLUING PROCESS DUE TO GLUE STAIN ENCOUNTERED AT LAMINATION MACHINE 1.		
WHY 2:	GLUE STAIN WAS DUE TO SCRAP LEFT ON THE GLUE ROLLER AND GLUE PLATE DURING RUNNING OF LOUVRE 2 MCX ICB ITEM.		
WHY 3:	SCRAP LEFT WAS NOT NOTICED BY THE FEEDER OPERATOR BEFORE FEEDING OF BOARDS.		
WHY 4:	TILTING AND TAPPING OF SF PRIOR FEEDING WAS NOT EXECUTE PROPERLY.		

## **IV. ACTION PLAN:**

## V. EVIDENCES:

1	REMIND THE OPERATOR ON THE ENCOUNTERED ISSUE OF PEEL OFF DUE TO GLUE STAIN AND TO STRENGTHEN THEIR CHECKPOINTS ON THE PROPER TAPPING OF SF/SB PRIOR FEEDING.	PIC: PRODUCTION IE TARGET DATE: MAY 23, 2023