


APPLICATION OF GLUE IN THE EDGE
OF THE GLUE TAB
(IMPROPER)

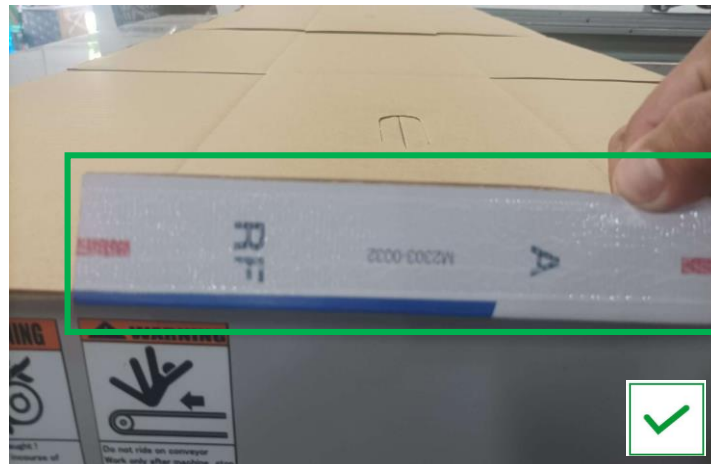

APPLICATION OF GLUE WITH
ALLOWANCE BEFORE THE EDGE
(PROPER)

MINUTES OF MEETING

K KANEPACKAGE PHILIPPINE INC.

MINUTES OF THE MEETING
 Date: 2024.09 Time Start: 5:00 Time Finished: 5:15 Venue: PEPPI AUTO SQUARE

ATTENDEES:					
Name	Dept.	Sign	Name	Dept.	Sign
Wilfred L. L. L.	People	(Sign)			
Michael C. C.	People	(Sign)			
Isabel C. C.	People	(Sign)			
Benjie S. S.	People	(Sign)			
John L. L.	People	(Sign)			
Robert B. B.	People	(Sign)			

AGENDA: 31. DISCUSS THE EXCESS GLUE ENCOUNTERED IN ITEM CODE 816298200 (LOUNGE & MICK ICB FOR ALIA, C)

MINUTES:
 WHY 1: PEEL OF ENCOUNTERED IN ITEM CODE 816298200 (LOUNGE & MICK ICB FOR ALIA, C) DURING PROCESS
 WHY 2: PEEL OFF CAUSED BY EXCESS GLUE
 WHY 3: THERE WAS EXCESS GLUE BECAUSE THE 2ND GLUE WAS APPLIED FURTHER INSIDE THE PANEL AWAY FROM THE GLUE TAB
 WHY 4: THICK GLUE GOT ON THE EDGE OF THE GLUE TAB SO THERE WAS AN EXCESS INSIDE THE PANEL WHEN THE OPERATOR MOVED THE GLUE ROLLER, AFFECTING THE PLACE OF THE GLUE ROLLER APPLICATION BECAUSE THE ROLLER MOVED AWAY FROM THE GLUE TAB OF THE PANEL
 NOTE: THE OPERATOR SHOULD HAVE ADJUSTED THE GLUE PLATE BECAUSE HE NOTICED THE UNEVEN GLUE ON THE ROLLER
 WHY 5: OPERATOR ALSO FAILED TO UNDORED TRIAL AFTER THE ADJUSTMENT OF THE GLUE PLATE
 IMPLEMENTATION: THAT EVERY ADJUSTMENT THEY MUST UNDERGO TRIAL SAMPLES

FOLLOW UP MEETING:
 (Date & Time)
 For KPMG fill up only
 Prepared by: _____ Reviewed by: _____ Noted by: _____