KANEPACKAGE PHILIPPINE INC. No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna Telephone No. (049) 545-7166 to 69 Fax No. (049) 545-6302

230523

INVESTIGATION REPORT

Prepared By:	Check By:	Approved By:
MHVITO	N. CEPEDA	R. MIRANDA
QA-IE/ Prodn IE	QA/ Prodn SV	KPLIMA Operations Gen. Mngr.

5M REVIEW		DOCUMENT REVIEW				
MAN	No Changes	Affected Document:	Date Reviewed:	Disposition:	PIC:	Target Date:
MACHINE	NTALLY PUSH THE EMERGEN	Procedure Manual		With Revision No Revision	MH.VITO	N/A
MATERIAL	No Changes	Work Instruction	230529	With Revision No Revision	MH.VITO	N/A
METHOD	No Changes	Process Flow		With Revision No Revision	MH.VITO	N/A
ENVIRONMENT	No Changes	Forms		With Revision No Revision	MH.VITO	N/A

I. PROBLEM DESCRIPTION

1.1. ISSUE:		
	GLUE STAIN	
1.2. ITEM DESCRIPTION:		
PART CODE:	515647100	
PART NAME:	LINUS CIS	
1.2 PACKCROUND:		

PICTURE

DATE:



DETAILS:

> LAMINATION MACHINE 1

> LOT QTY: 200 > REJECT: 140 > REJECTION%: 70

II. IMMEDIATE ACTION

ACTION ITEMS	Target Date:	Person In-charge
SEGREGATION OF THE AFFECTED PANEL AND CLEAN ROLLER	2'230523	OPERATOR
RESET THE EMERGENCYY STOP BUTTON	230518	OPERATOR

III. CAUSE ANALYSIS:

WHY 1:	GLUE STTAIN OCCUR AT LAMINATION 1 FOR LINUS ITEM
WHY 2:	GLUE STAIN DUE TO GLUE ATT WATER ROLLER
WHY 3	THE GLUE ON THE GLUE ROLLER LAEK AT THE WATTER ROLLER
WHY 4:	THE EMERGENCY STOP ACCIDENTALLY PUSH BY THE OPERATOR AND THEY DID NOT NOTICE OR CHECK THE WATER ROLLER IF ACCUMULATED BY GLUE

IV. ACTION PLAN: V. EVIDENCES:

	1	REMIND THE OPERATOR TO THE ISSUE REGARDING TO THE GLUE STAIN AT LINUS ITEM	230518
2	2	REQUEST COVER TO THE EMERGENCY STOP TO AVOID ACCIDENT ON PRESSING	



Prepared By:	Check By:	Approved By:
MHVITO	N. CEPEDA	R. MIRANDA
OA-IF/ Prodn IF	OA/ Prodn SV	KPI IMA Operations Gen. Mngr.

INVESTIGATION REPORT

DATE:	<u>230523</u>
-------	---------------