	EPACKAGE PHILIPP Road USP II, Brgy, La Mesa, Calamba Cey, Li		INVESTIGATION REPORT						
Telephone No. (949) 545-7156 to 69 Fas No. (149) 545-6302			Prepared By: WOLUM K.N.ACUIN		Check By:		Approved By: Approved By: R. Approved R.		
DATE:	JANUARY 10, 20	024	QA-IE/ Prodn IE	QA-IE/ Prodn IE QA/ Prod			SV KPLIMA Operation's Prod Mngr./		
5M	REVIEW			DO	CUMENT REV	(EW			
MAN MACHINE	No Changes No Changes	Affected Document: Procedure Manual	Date Reviewed:	a With Revision	Disposition:	No Revision	PIC: K.N.ACUIN	Target Date: N/A	
MATERIAL	No Changes	Work Instruction	1	With Revision	0	No Revision	K.N.ACUIN	N/A	
METHOD	No Changes	Process Flow	240110	☐ With Revision	0	No Revision	K.N.ACUIN	N/A	
ENVIRONMENT	No Changes	Forms		O With Revision	Ø	No Revision	K.N.ACUIN	N/A	
PROBLEM DE	SCRIPTION							Service of the Control of the Contro	
.1. ISSUE:	MIXED MODEL								
2. ITEM DESCR									
PART COD		OR EOD CHIMA: C							
3. BACKGROUN		B FOR CHINA, C							
Signal displayed on the constant of the consta		>Inhouse Dete >Lot size: 1537 > Reject Qty: 1 >Rejection Rat	pc						
IMMEDIATE A		TTTHE		Target Date:			Person In-charge		
ACTION ITEMS DINDUCT MEETING REGARDING MIXED PANEL				Target Date: 240111			Person in-charge		
							IE STAFF		
III. CAUSE AN	ALYSIS:								
WHY 1: WHY MIXED MODEL OCCURRED? OPERATOR DIDN'T NOTICE THAT THERE WAS A MIXED MODEL ENT			L ENTERED DURING MASS PRODUCTION	ERED DURING MASS PRODUCTION					
WHY 2:	WHY OPERATOR DIDN'T BARCODE SCANNER MALFL	F NOTICE THE ENTRY OF THE MI UNCTION IN THE MIDDLE RUN OF N	XED MODEL? IASS PRODUCTION AND THE OPERATOR	ODEL? ODUCTION AND THE OPERATOR FAILED TO UPDATE THE BARCODE ERROR			PATRICING PARTY AND		
WHY 3: WHY THE BARCODE SCANNER MALFUNCTION DURING THE WIRE LOOSE INSIDE THE BARCODE SCANNER			MASS PRODUCTION?						
IV. ACTION P	LAN:				V.	EVIDENCES:			
1 CONDUCT MEETING/ RE ORIENTATION REGARDING TO THE ISSUE OF MIXED M			IXED MODEL	DDEL.			PIC: IE STAFF/LINELEADER/OPERATOR TARGET DATE: JANUARY 11, 2024		
REVISON OF WI TO INCLUDE THE FOLLOWING: FEEDER OPERATOR - UNICODDING OF ALL PANELS AT THE FEEDING AREA TO CHECK THE POSSIBLE ERROR FOLDER OPERATOR 2 - SLIGHT LIFTING THE GLUED PANELS TO CHECK THE BARCODE OF BOTH PANELS -RELEASE ALL THE ITEMS INSIDE THE CONVEYOR CATCHER OPERATOR - CHECKING/BROWSING ALL THE GLUED ITEMS						PIC: IE STAFF/LINELEADER/OPERATOR TARGET DATE: JANUARY 2024			
3 STRENGTHEN IMPLEMENTATION OF UPDATING BARCODE ERROR IN PRODUCTION DAILY OUT MACHINE SET UP/ DOWNTIME						PIC: IE STAFF/LINELEADER/SUBLEADER/OPERATOR TARGET DATE: JANUARY 2024			