



KANEPACKAGE PHILIPPINE INC.

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna
Telephone No. (049) 5457-7166 to 69
Fax No. (049) 545-6302

INVESTIGATION REPORT FORM (IRF)

Control No.:


Date Issued

0018

241011

Customer	KOWA-EMORI PHILIPPINES, INC.	Attention To	WEENA APALLA
Item Code	HP33D1057-1 EQOS	Department	PRODUCTION
Item Description	CARTON BOX	Date of Detection	241007
Job Order Number	JO24-M-01612-9	Section Detected	QA SCREENING 4

ILLUSTRATION OF THE PROBLEM

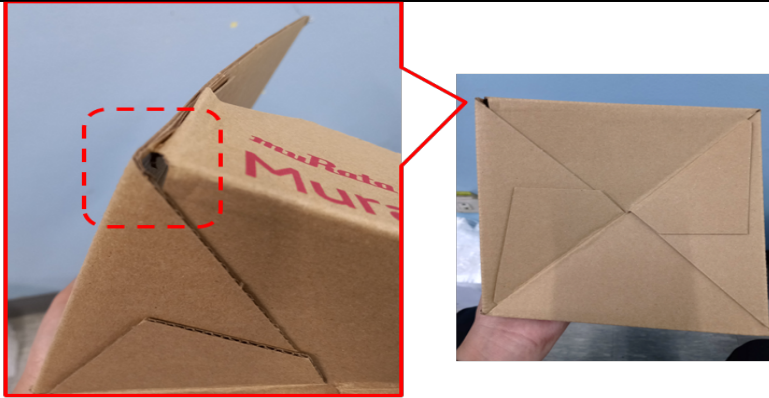

ACTUAL: With misalign glue
REQUIREMENT: No misalign glue

Lot Quantity (pcs)	Reject Qty (pcs)	Reject %
3000	45	1.50

Nature of Defect:

MISALIGN GLUE

Requirement:

There should be no gap

Actual

Gap on on the corner of the box due to misalign glue

NO. OF OCCURENCE	DISPOSITION	AREA OF OCCURENCE / ORIGIN	CONTENT
<input checked="" type="checkbox"/> First <input type="checkbox"/> Recurrence No.: <u>1</u> Date.: <u>241007</u>	<input type="checkbox"/> Hold <input type="checkbox"/> Special Acceptance <input type="checkbox"/> For Rework <input checked="" type="checkbox"/> Reject / Disposal	<input type="checkbox"/> Slotter <input type="checkbox"/> EQOS <input type="checkbox"/> Diecut <input type="checkbox"/> Detaching <input checked="" type="checkbox"/> Gluing <input type="checkbox"/> Vertical <input type="checkbox"/> Others	<input type="checkbox"/> Material <input type="checkbox"/> Dimension <input type="checkbox"/> Appearance <input checked="" type="checkbox"/> Process / Method
Issued by	Checked by	Approved by	Received by (Receiving Section)
LESTER JOHN DIOSO 241011	CHARLENE JAN MARIE FLORES 241011	MICHAEL CASILLANO 241015	GERALD DE GUZMAN 241016

I. INVESTIGATION / ANALYSIS

DIRECT CAUSE: (Analyze the reason of occurrence, why it happened?)

System / Training

Design / Toolings

Process / Material



KANEPACKAGE PHILIPPINE INC.

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna
Telephone No. (049) 5457-7166 to 69
Fax No. (049) 545-6302

INVESTIGATION REPORT FORM (IRF)

INDIRECT CAUSE: (Analyze the reason of occurrence, why it leaked?)

System / Training

Design / Toolings

Process / Material

FINAL CONCLUSION

CORRECTIVE ACTION: (Actions to be done to ensure that the problem will not happen again)

WHO / WHEN

IMMEDIATE ACTION: (Action to be done to contain/ temporary correct the problem found)

A. Sorting Result					C. Reworking	
	Location	Total Stock	NG	Total Good	Rework Quantity	n/a
RM	n/a	0	0	0	Total Good	0
WIP	n/a	0	0	0	Rework PPM (Good)	0
FG	n/a	0	0	0		
B. Orientation						
Date	2024-12-05				Time	08:13
Title	Production Weekly Assembly Meeting					
Attendees	All Production					
Prepared By:					Approved By:	
GERALD DE GUZMAN 250128					REXEL ALMARIO 250205	
					Department Head	



II. QA ROOTCAUSE VERIFICATION (To be filled out by QA In-charge)

Date Conducted: 2024-10-11	PIC: M.ASIS
Identified Rootcause Movement of reverse creasing matrix during running	Recommendation N/A

III. CORRECTIVE ACTION VERIFICATION (To be filled out by QA In-charge)

	Checked By:	Date	Implemented?	Running	JO Number	Date	NG Qty	Lot Qty
1st Verification of Action	M. ASIS	2024-11-06	[/] Yes [] No	1st	JO24-M-02017-28	241206	0	3000
2nd Verification of Action			[] Yes [] No	2nd	JO24-M-02017-29	241209	0	4000
3rd Verification of Action			[] Yes [] No	3rd	JO24-M-02017-55	241219	0	4000
Effectiveness of Action	M. ASIS	2025-01-06	[/] Yes [] No	4th	JO24-M-02017-56	241226	15	35000
Remarks: Included the checking of checklist for one-touch lock model in Eterna Machine Set-up and Operation (WI-PR-002-034) The revision was on Rev. 11 Page 1.				5th	JO24-M-02413-31	250106	5	3000

IV. CLOSURE

Status	Remarks
Closed IRF	Five consecutive lots running with minimal rejects only (20pcs.)

Approved by:		Process Owner Acknowledgment: (Receiving Section)	
MICHAEL CASILLANO 250310 12:56 QA Head	KOHEI ISHII 250313 09:08 Top Management	GERALD DE GUZMAN 250318 03:36 Line Leader	REXEL ALMARIO 250507 11:24 Department Head
Date: 25252525-03-10	Date: 25252525-03-13	Date: 25252525-03-18	Date: 25252525-05-07