

**KANEPACKAGE PHILIPPINE INC.**

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna  
 Telephone No. (049) 5457-7166 to 69  
 Fax No. (049) 545-6302

**INVESTIGATION REPORT FORM (IRF)**

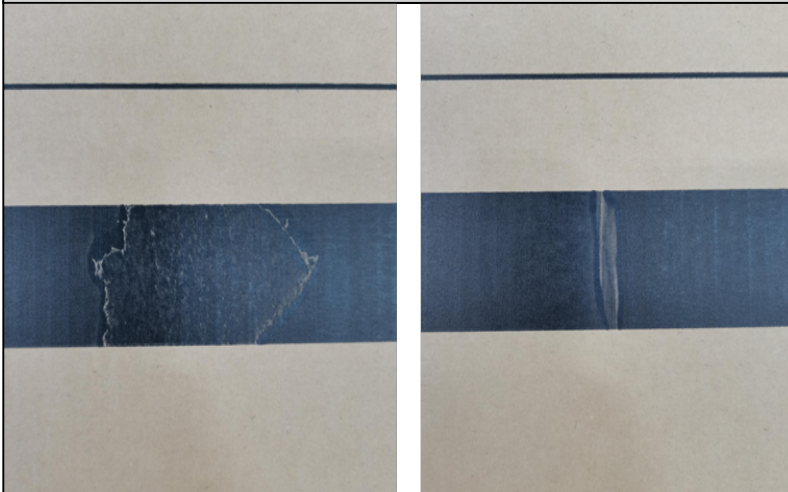
Control No.:

Date Issued

0079

250329

Customer	BROTHER INDUSTRIES PHILIPPINES, INC.	Attention To	REXEL ALMARIO
Item Code	D037FX001	Department	PRODUCTION
Item Description	CARTON MFC-J4350DW EU-C	Date of Detection	250324
Job Order Number	JO-25-IPD-00394-1A	Section Detected	QA SCREENING

**ILLUSTRATION OF THE PROBLEM**

Lot Quantity (pcs)	Reject Qty (pcs)	Reject %
1700	86	5.06

Nature of Defect:

POOR PRINT

Requirement:

Level 1 and 2 Poor print is acceptable.

Actual

Level 3 condition of poor print on solid print.

NO. OF OCCURENCE	DISPOSITION	AREA OF OCCURENCE / ORIGIN		CONTENT
<input checked="" type="checkbox"/> First <input type="checkbox"/> Recurrence No.: <u>1</u> Date.: <u>250324</u>	<input type="checkbox"/> Hold <input type="checkbox"/> Special Acceptance <input type="checkbox"/> For Rework <input checked="" type="checkbox"/> Reject / Disposal	<input type="checkbox"/> Slotter <input checked="" type="checkbox"/> EQOS <input type="checkbox"/> Diecut <input type="checkbox"/> Detaching	<input type="checkbox"/> Gluing <input type="checkbox"/> Vertical <input type="checkbox"/> Others	<input type="checkbox"/> Material <input type="checkbox"/> Dimension <input type="checkbox"/> Appearance <input checked="" type="checkbox"/> Process / Method

Issued by	Checked by	Approved by	Received by (Receiving Section)
LESTER JOHN DIOSO   250329	CHARLENE JAN MARIE FLORES   250421	MICHAEL CASILLANO   250422	GERALD DE GUZMAN   250506

**I. INVESTIGATION / ANALYSIS****DIRECT CAUSE: (Analyze the reason of occurrence, why it happened?)****System / Training****Design / Toolings****Process / Material**

WHY 1 : Uneven distribution of ink to the substrate.

WHY 2 : r n There is blockage of anilox.

WHY 3 : Foreign materials that was stick in the flexo plate that adhere in the anilox.

**KANEPACKAGE PHILIPPINE INC.**

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna  
 Telephone No. (049) 5457-7166 to 69  
 Fax No. (049) 545-6302

**INVESTIGATION REPORT FORM (IRF)****INDIRECT CAUSE: (Analyze the reason of occurrence, why it leaked?)****System / Training****Design / Toolings****Process / Material**

WHY 1 : na

**FINAL CONCLUSION****CORRECTIVE ACTION: (Actions to be done to ensure that the problem will not happen again)****WHO / WHEN****Process / Material**

WHY 1: Set Frequency of dust remover cleaning to every end of r nth shift.

Production // 2025-09-04

**IMMEDIATE ACTION: (Action to be done to contain/ temporary correct the problem found)**

A. Sorting Result

C. Reworking

	Location	Total Stock	NG	Total Good	Rework Quantity	na
RM	na	0	0	0	Total Good	na
WIP	na	0	0	0	Rework PPM (Good)	na
FG	na	0	0	0		

B. Orientation

Date	2025-09-04	Time	17:20
Title	na		
Attendees	NA		

Prepared By:

Approved By:

GERALD DE GUZMAN | 250904

REXEL ALMARIO | 260427

Department Head

**KANEPACKAGE PHILIPPINE INC.**

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna  
 Telephone No. (049) 5457-7166 to 69  
 Fax No. (049) 545-6302

**INVESTIGATION REPORT FORM (IRF)****II. QA ROOTCAUSE VERIFICATION (To be filled out by QA In-charge)**

Date Conducted:	PIC:
Identified Rootcause	Recommendation

**III. CORRECTIVE ACTION VERIFICATION (To be filled out by QA In-charge)**

	Checked By:	Date	Implemented?	Running	JO Number	Date	NG Qty	Lot Qty
1st Verification of Action			[ ] Yes [ ] No	1st				
2nd Verification of Action			[ ] Yes [ ] No	2nd				
3rd Verification of Action			[ ] Yes [ ] No	3rd				
Effectiveness of Action			[ ] Yes [ ] No	4th				
Remarks:				5th				

**IV. CLOSURE**

Status	Remarks
Still Open	

Approved by:		Process Owner Acknowledgment: (Receiving Section)	
N/A	N/A	N/A	N/A
QA Head	Top Management	Line Leader	Department Head
Date: -	Date: -	Date: -	Date: -