

**KANEPACKAGE PHILIPPINE INC.**

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna
 Telephone No. (049) 5457-7166 to 69
 Fax No. (049) 545-6302

INVESTIGATION REPORT FORM (IRF)

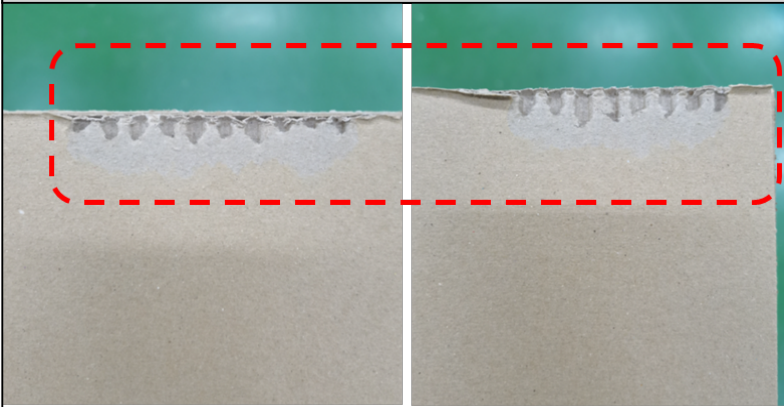
Control No.:

Date Issued

0084

250422

Customer	EPSON PRECISION PHILS. INC.- ASP/EPLB	Attention To	REXEL ALMARIO
Item Code	513238500	Department	PRODUCTION
Item Description	OUTER CARTON BOX	Date of Detection	250410
Job Order Number	JO25-M-01152-34	Section Detected	QA SCREENING 5

ILLUSTRATION OF THE PROBLEM

Lot Quantity (pcs)	Reject Qty (pcs)	Reject %
500	20	4.00

Nature of Defect:

PEEL OFF

Requirement:

Maximum of 25mm is still Acceptable

Actual

Peel off up to 70mm length

ACTUAL: Peel off up to 70mm length
REQUIREMENT: Maximum of 25mm is still Acceptable

NO. OF OCCURENCE	DISPOSITION	AREA OF OCCURENCE / ORIGIN	CONTENT
<input type="checkbox"/> First <input checked="" type="checkbox"/> Recurrence No.: <u>2</u> Date.: <u>250405</u>	<input type="checkbox"/> Hold <input type="checkbox"/> Special Acceptance <input type="checkbox"/> For Rework <input checked="" type="checkbox"/> Reject / Disposal	<input type="checkbox"/> Slotter <input checked="" type="checkbox"/> EQOS <input type="checkbox"/> Diecut <input type="checkbox"/> Detaching <input type="checkbox"/> Gluing <input type="checkbox"/> Vertical <input type="checkbox"/> Others	<input type="checkbox"/> Material <input type="checkbox"/> Dimension <input type="checkbox"/> Appearance <input checked="" type="checkbox"/> Process / Method
Issued by	Checked by	Approved by	Received by (Receiving Section)
LESTER JOHN DIOSO 250422	CHARLENE JAN MARIE FLORES 250423	MICHAEL CASILLANO 250424	GERALD DE GUZMAN 250506

I. INVESTIGATION / ANALYSIS**DIRECT CAUSE: (Analyze the reason of occurrence, why it happened?)****System / Training****Design / Toolings****Process / Material**

WHY 1 : The liner surface of the board was hit on the feed gate of Eqos during running.

WHY 2 : Presence of excess liner and delamination in the edge of the boards.

**KANEPACKAGE PHILIPPINE INC.**

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna
 Telephone No. (049) 5457-7166 to 69
 Fax No. (049) 545-6302

INVESTIGATION REPORT FORM (IRF)**INDIRECT CAUSE: (Analyze the reason of occurrence, why it leaked?)****System / Training****Design / Toolings****Process / Material**

WHY 1 : NA

FINAL CONCLUSION**CORRECTIVE ACTION: (Actions to be done to ensure that the problem will not happen again)****WHO / WHEN****Process / Material**

WHY 1: Assign Packageworld as main supplier of materials for this item. This based on checking and trial run conducted using materials from Sunpack and Packageworld.

Purchasing and MPD // 2025-06-24

IMMEDIATE ACTION: (Action to be done to contain/ temporary correct the problem found)

A. Sorting Result

C. Reworking

	Location	Total Stock	NG	Total Good	Rework Quantity	na
RM	na	0	0	0	Total Good	0
WIP	na	0	0	0	Rework PPM (Good)	0
FG	na	0	0	0		

B. Orientation

Date	2025-06-10			Time	11:16
Title	na				
Attendees	na				

Prepared By:

Approved By:

GERALD DE GUZMAN | 250625

REXEL ALMARIO | 260427

Department Head

**KANEPACKAGE PHILIPPINE INC.**

No. 5 Ring Road LISP II, Brgy. La Mesa, Calamba City, Laguna
 Telephone No. (049) 5457-7166 to 69
 Fax No. (049) 545-6302

INVESTIGATION REPORT FORM (IRF)**II. QA ROOTCAUSE VERIFICATION (To be filled out by QA In-charge)**

Date Conducted:	PIC:
Identified Rootcause	Recommendation

III. CORRECTIVE ACTION VERIFICATION (To be filled out by QA In-charge)

	Checked By:	Date	Implemented?	Running	JO Number	Date	NG Qty	Lot Qty
1st Verification of Action			[] Yes [] No	1st				
2nd Verification of Action			[] Yes [] No	2nd				
3rd Verification of Action			[] Yes [] No	3rd				
Effectiveness of Action			[] Yes [] No	4th				
Remarks:				5th				

IV. CLOSURE

Status	Remarks
Still Open	

Approved by:		Process Owner Acknowledgment: (Receiving Section)	
N/A	N/A	N/A	N/A
QA Head	Top Management	Line Leader	Department Head
Date: -	Date: -	Date: -	Date: -